


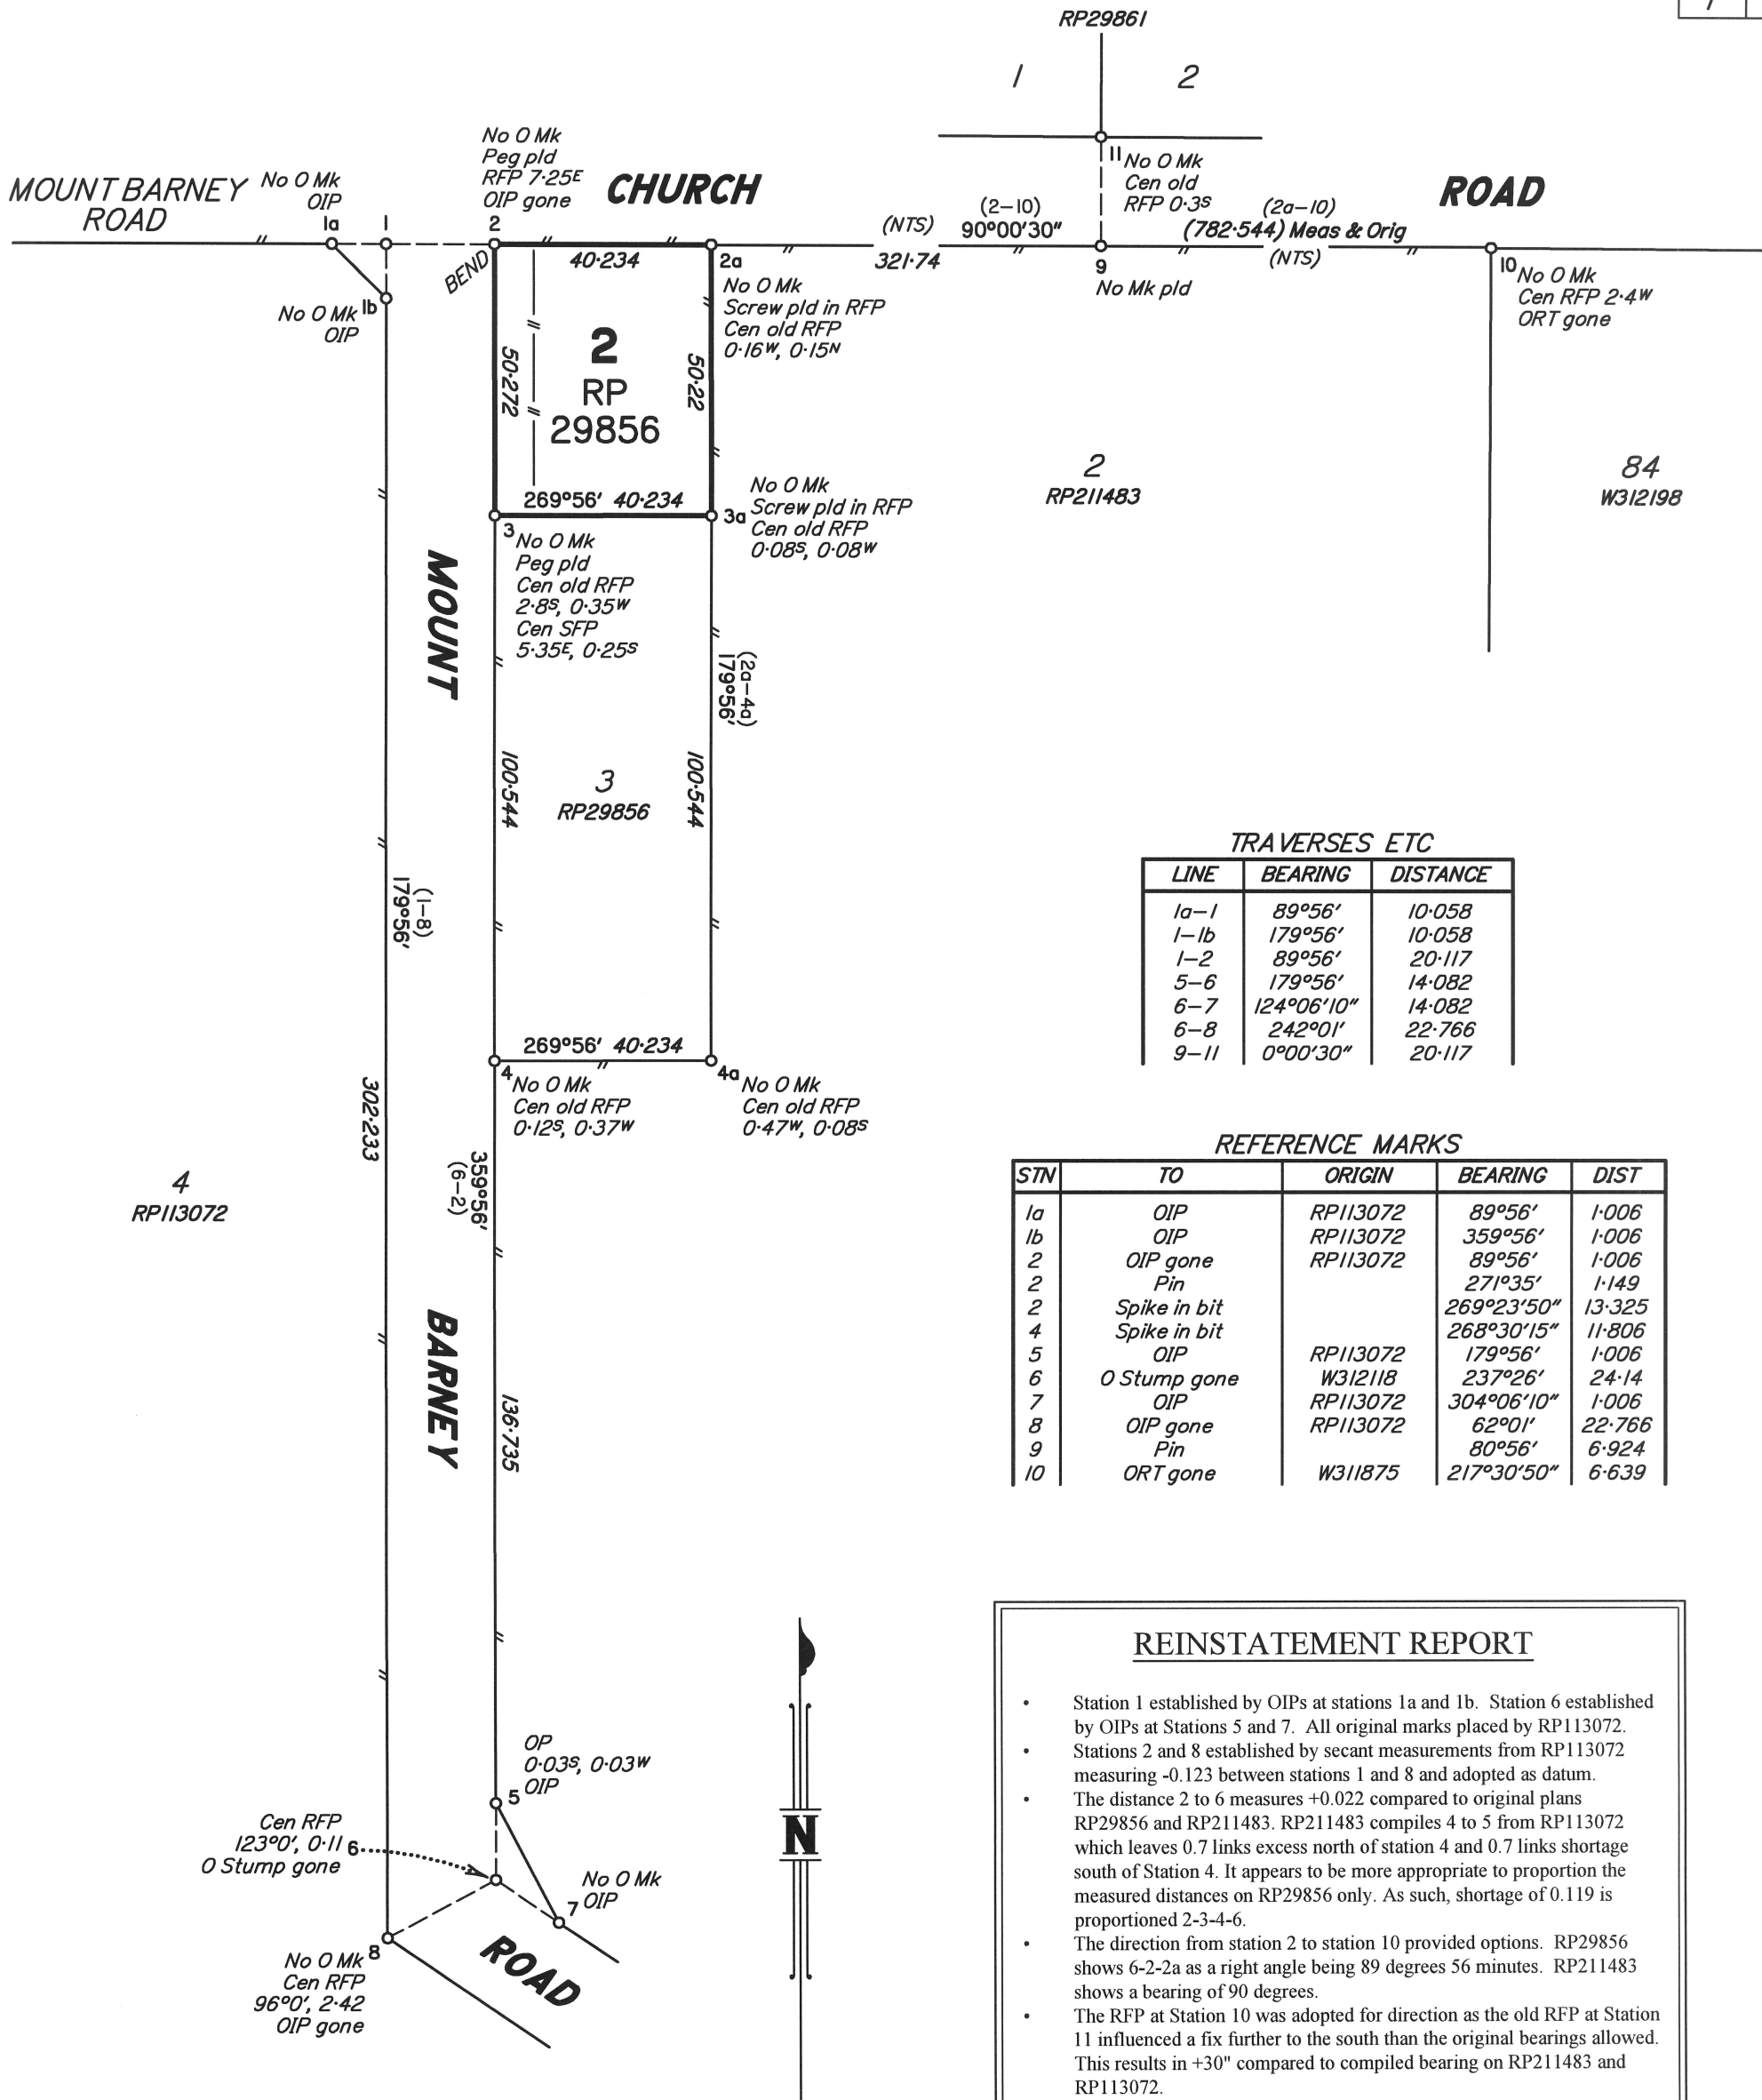

TRAVERSES ETC		
LINE	BEARING	DISTANCE
1a-1	89°56'	10.058
1-1b	179°56'	10.058
1-2	89°56'	20.117
5-6	179°56'	14.082
6-7	124°06'10"	14.082
6-8	242°01'	22.766
9-11	0°00'30"	20.117

REFERENCE MARKS				
STN	TO	ORIGIN	BEARING	DIST
1a	OIP	RP113072	89°56'	1.006
1b	OIP	RP113072	359°56'	1.006
2	OIP gone	RP113072	89°56'	1.006
2	Pin		271°35'	1.149
2	Spike in bit		269°23'50"	13.325
4	Spike in bit		268°30'15"	11.806
5	OIP	RP113072	179°56'	1.006
6	O Stump gone	W312118	237°26'	24.14
7	OIP	RP113072	304°06'10"	1.006
8	OIP gone	RP113072	62°01'	22.766
9	Pin		80°56'	6.924
10	ORT gone	W311875	217°30'50"	6.639

REINSTATEMENT REPORT

- Station 1 established by OIPs at stations 1a and 1b. Station 6 established by OIPs at Stations 5 and 7. All original marks placed by RP113072.
- Stations 2 and 8 established by secant measurements from RP113072 measuring -0.123 between stations 1 and 8 and adopted as datum.
- The distance 2 to 6 measures +0.022 compared to original plans RP29856 and RP211483. RP211483 compiles 4 to 5 from RP113072 which leaves 0.7 links excess north of station 4 and 0.7 links shortage south of Station 4. It appears to be more appropriate to proportion the measured distances on RP29856 only. As such, shortage of 0.119 is proportioned 2-3-4-6.
- The direction from station 2 to station 10 provided options. RP29856 shows 6-2-2a as a right angle being 89 degrees 56 minutes. RP211483 shows a bearing of 90 degrees.
- The RFP at Station 10 was adopted for direction as the old RFP at Station 11 influenced a fix further to the south than the original bearings allowed. This results in +30" compared to compiled bearing on RP211483 and RP113072.
- Station 2a fixed deed distance from 2 on the alignment 2 to 10.
- Stations 3a and 4a fixed at right angles and deed distances off stations 3 and 4 respectively as intended by the RP29856.
- Occupation at 2a, 3a and 4a generally support the north-south fix.

TJ KELLY SURVEYS PTY LTD (ACN 058 752 417) hereby certify that the land comprised in this plan was surveyed by the corporation, by Timothy John KELLY, Cadastral Surveyor for whose work the corporation accepts responsibility, and that the plan is accurate, that the said survey was performed in accordance with the Survey and Mapping Infrastructure Act 2003 and Surveyors Act 2003 and associated Regulations and Standards and that the said survey was completed on 03/06/2024.

Date 12.7.2024 Director

TJ KELLY SURVEYS PTY LTD
CONSULTING SURVEYORS & TOWN PLANNERS
ACN 058 752 417

OFFICE: 111 Brisbane Street, BEAUDESERT
Phone: (07) 5541 4722
Facsimile: (07) 5541 4723
Email: admin@kellynet.com.au
Web: www.kellynet.com.au

Metres 0 62.5m 50 | mm 125m 100 | mm 187.5m 150 | mm

TITLE IDENTIFICATION SURVEY OF

Lot 2 on RP29856

CLIENT SERENDIPITY

NOTES BD24223

LOCALITY		ORIG	LOCAL AUTH.		
BARNEY VIEW		Por 38V	SCENIC RIM R.C.		
MAP REF.	MERIDIAN	SCALE	DATE	JOB No.	DRAWING No.
9441-13332	RP113072	1:1250	12/07/2024	4832	

IS322848